

# SERVICE BULLETIN



M-1113

August 13, 2001

## 2002 EFI VEHICLE TSM/TSSM MODULE CHANGE

### Purpose

A change has been made to the TSM/TSSM module because of an ECM change on 2002 EFI vehicles. This change has resulted in a part number revision for the TSM/TSSM modules. The new part numbers have a suffix of -00A and -01A.

TSM/TSSM modules produced before this revision cannot be used on motorcycles affected.

### Motorcycles Affected

2002 EFI Softail and Touring Models.

#### NOTE

2001 and 2002 carbureted vehicles are not affected by this change.

### Required Dealer Action

-00A and -01A TSM/TSSM modules will function on any 2001 or 2002 EFI or carbureted vehicle configured for TSM/TSSM use.

Your inventory of -00 and -01 TSM/TSSM modules can be used for all applications **except 2002 EFI vehicles**. If a -00 or -01 TSM/TSSM module is used on a 2002 EFI motorcycle, a false diagnostic trouble code U1064 could be set in the ECM.

#### IMPORTANT NOTE

**-00 and -01 TSM/TSSM modules are not to be returned to Harley-Davidson Motor Company as defective stock.**

Table 1. TSM/TSSM Usage – 2001 and 2002 EFI Motorcycles

Part Number	Type	2001 FL	2002 FL	2001 Softail	2002 Softail	2001 FLTRSEI <sup>2</sup>	2002 FLHRSEI
68920-01	TSM (Dom/HDI)	√					
68920-01A	TSM (Dom/HDI)	√	√				√
68921-01	TSM (Dom/HDI)			√			
68921-01A	TSM (Dom/HDI)			√	√		
68922-00	TSSM (Dom)	√				√	
68922-00A	TSSM (Dom)	√	√			√	√
68923-00	TSSM (Dom)			√			
68923-00A	TSSM (Dom)			√	√		
68924-00	TSSM (HDI)	√					
68924-00A	TSSM (HDI)	√	√				√
68925-00	TSSM (HDI)			√			
68925-00A	TSSM (HDI)			√	√		

√ – Specified TSM/TSSM (row) can be used on specified vehicle (column)

ROUTING	SERVICE MANAGER	SALES MANAGER	PARTS MANAGER	LEAD TECHNICIAN	TECHNICIAN NO.1	TECHNICIAN NO. 2	TECHNICIAN NO. 3	TECHNICIAN NO. 4	RETURN THIS TO
INITIAL HERE									