SERVICE BULLETIN

HARLEY-DAVIDSON

M-1131 February 7, 2003

SPORTSTER REAR WHEEL SPACER IDENTIFICATION

Purpose

Some 2003 Sportster motorcycles were produced with incorrect rear wheel spacers (left side). The incorrect spacer has a length difference that may affect the assembly stack up of the rear wheel components. This can cause the rear brake to make a noise similar to a lightly applied rear brake.

Motorcycles Affected

2003 Sportster models built between 9/3/02 and 9/11/02.

Required Dealer Action

If the customer complains of an unusual sound from the rear of the motorcycle, verify which left spacer the rear wheel contains by referring to Figure 1 below for visual identification. If replacement is required, replace the spacer per instructions in the appropriate service manual. The part number of the correct spacer is 43654-00A.

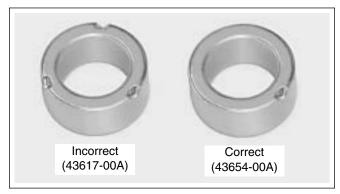


Figure 1. Rear Wheel Spacer Identification

Credit Procedure

Complete a regular warranty claim referencing Service Bulletin M-1131 in the "Description of Repair" or "Comments" section of the claim. Fill in the rest of the claim as follows:

Credit procedure - Inspect Only

| Claim Type | MC* | | | |
|-----------------------------|-------------------|--|--|--|
| Quantity | 0 | | | |
| Event 1, Problem Part No. | 43654-00A | | | |
| Part Description | Rear wheel spacer | | | |
| Customer Concern Code | 9203 | | | |
| Condition Code | 9111 | | | |
| Primary Labor Code, Inspect | 2117 | | | |
| Time Allowed | 0.1 | | | |
| | | | | |

^{*} Other claim types may be applicable, depending on warranty and/or status of vehicle.

Credit Procedure - Replace Spacer

| Claim Type | MC* | | | |
|-------------------------------|-------------------|--|--|--|
| Quantity | 0 | | | |
| Event 1, Problem Part No. | 43617-00A | | | |
| Part Description | Rear wheel spacer | | | |
| Quantity, Additional Part No. | 1 | | | |
| Event 1, Additional Part No. | 43654-00A | | | |
| Part Description | Rear wheel spacer | | | |
| Customer Concern Code | 9203 | | | |
| Condition Code | 9111 | | | |
| Primary Labor Code, Replace | 2118 | | | |
| Time Allowed | 0.3 | | | |

^{*} Other claim types may be applicable, depending on warranty and/or status of vehicle.

Upon receipt and processing of the properly completed claim, you will be credited the appropriate amount for parts and/or labor.

IMPORTANT NOTE

In the interest of preserving customer safety and satisfaction, always check for outstanding recalls whenever any motorcycle is brought into your dealership for either maintenance or service.

| ROUTING | SERVICE MANAGER | SALES MANAGER | PARTS MANAGER | LEAD TECHNICIAN | TECHNICIAN NO.1 | TECHNICIAN NO. 2 | TECHNICIAN NO. 3 | TECHNICIAN NO. 4 | RETURN THIS TO | |
|-------------------------------------|--------------------|------------------|------------------|--------------------|--------------------|---------------------|---------------------|---------------------|-------------------|--|
| INITIAL HERE | | | | | | | | | | |
| ©2003 HARLEY-DAVIDSON MOTOR COMPANY | | | | | | | | | | |

M-1131 1 of 1