

SERVICE BULLETIN

M-1190

June 19, 2006



2006 TOURING FORK LOCK PRODUCT PROGRAM 0900

Purpose

Harley-Davidson Motor Company, Inc. has learned that the fork lock on 2006 Touring Models can be broken if the rider attempts to turn the handlebars while the forks are locked. If the spring or cam connecting link is broken, the locking barrel will not retract from the boss on the frame bracket.

Unlocking the switch knob with the ignition key will not unlock the forks. Repairing the lock will require removal and replacement of the ignition/light key switch and fork lock.

Motorcycles Affected

All 2006 Touring Models, except FLHR, built from June 11, 2005 through February 2, 2006. These vehicles are identified by the attached Vehicle Identification Number (VIN) list.

Customer Notification

Harley-Davidson Motor Company, Inc. will provide notice to all owners of record of affected products with directions to bring the motorcycle in for service.

Required Dealer Action

Wave Shipments

Harley-Davidson's Warranty Department will conduct wave shipments of replacement parts (P/N 94462) until further notice. The initial wave shipment will take place the week of June 19.

Unlike previous product programs, parts for this product campaign will be shipped no charge, transportation paid, UPS Ground.

Order Additional Kits

If additional kits are needed, fill in the attached order form and fax it to the Warranty Department (414-343-8346). Be sure to include the dealer number on the form.

NOTE

No kit orders will be accepted prior to the availability date. Orders received prior to termination of wave shipments will be discarded.

Installation

See Figure 1. Replace existing OE fork lock (1) with the replacement (2) from the Product Program. Refer to IGNITION/LIGHT KEY SWITCH AND FORK LOCK service procedures in the 2006 Touring Models Service Manual.

See **Operation** and Figure 2. After installation of the replacement switch, explain the new operation procedures of the fork lock to the customer.

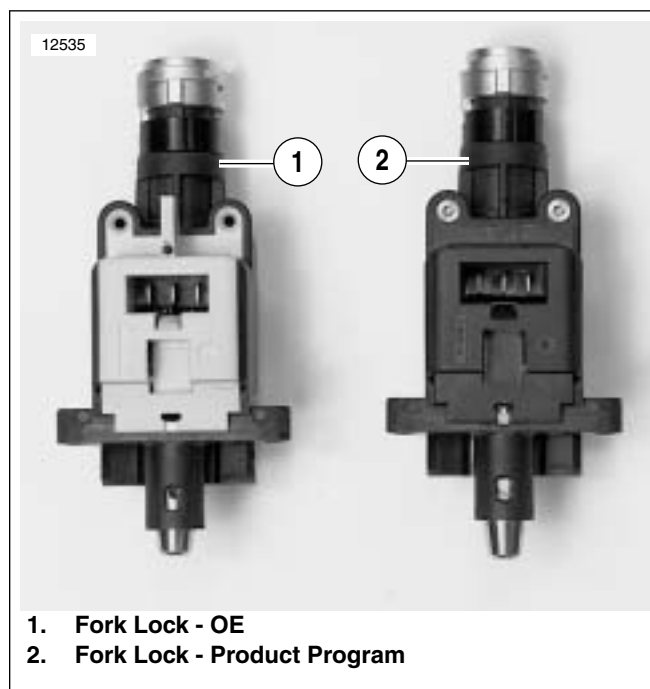


Figure 1. Touring Model Ignition Switch/Fork Lock

IMPORTANT NOTE

In the interest of preserving customer safety and satisfaction, always check for outstanding recalls whenever any motorcycle is brought into your dealership for either maintenance or service.

ROUTING	SERVICE MANAGER	SALES MANAGER	PARTS MANAGER	LEAD TECHNICIAN	TECHNICIAN NO.1	TECHNICIAN NO. 2	TECHNICIAN NO. 3	TECHNICIAN NO. 4	RETURN THIS TO
INITIAL HERE									

©2006 HARLEY-DAVIDSON MOTOR COMPANY

Operation

CAUTION

Protect your vehicle against theft. After parking your motorcycle, lock the steering head and remove ignition key from switch. Failure to lock your motorcycle may result in theft and/or equipment damage. (00151a)

To Lock Fork:

- 1. See Figure 2. Turn the front forks to full left lock and insert ignition key into key lock (2).
- 2. Turn switch knob (1) to FORK LOCK and push knob down.
- 3. While holding knob down, turn key to LOCK and remove key.

NOTE

The key lock can be locked with the switch knob in the ACCESS position without locking the forks. Remove the key for security. Should it be necessary to park along side a road-way with the hazard warning flashers ON and with the brake light and horn active, the ignition can be disabled.

To Unlock Fork:

- 1. Insert ignition key into key lock.
- 2. Push in and turn to UNLOCK. The switch knob will pop up.
- 3. Turn switch knob to OFF.

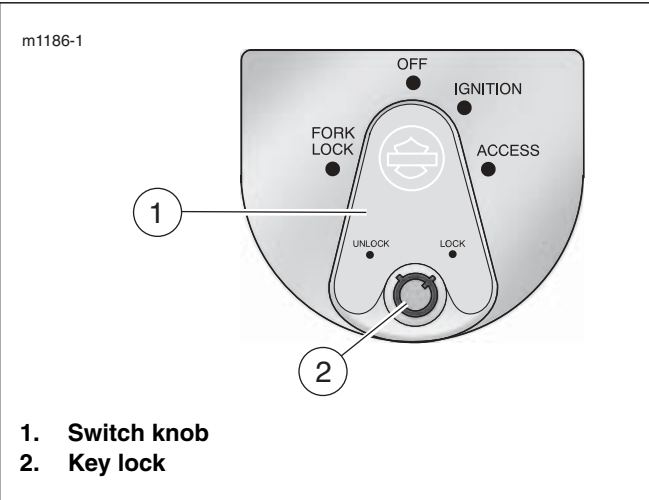


Figure 2. Switch Knob and Key Lock Positions

Credit Procedure - Vehicle

Complete a warranty claim referencing Service Bulletin M-1190. Fill in the rest of the claim as follows:

Claim Type	PPC *
Event Problem Part No.	71530-03A
Part Description	Fork Lock
Quantity	Leave Blank
Primary Labor Code	5129
Time	0.7 hrs.
Customer Concern Code	0900
Condition Code	2202
Event 1 Additional Part No.	94462
Description	Fork Lock Replacement Kit
Quantity	1

* Please note the new claim type.

Return Shipping Information

Upon receipt and processing of the properly completed warranty claim, a bar coded label with the part number of the replacement kit (P/N 94462) will be sent to return with each replaced lock. Be sure to tag each part separately and return before the due date on the parts return tag.

Once the replaced ignition switch/fork lock has been received by the designated due date, the claim will be credited and the dealer will be reimbursed for labor and return postage. No credit will be issued for parts as they were sent no charge, transportation paid.

Credit Procedure - Parts-In-Stock

Remove and hold all 71530-03A fork locks from inventory. To receive credit, complete a warranty claim referencing Service Bulletin M-1190 in the description of the repair section. Fill in the rest of the claim as follows:

Claim Type	DFS
Event Problem Part No., Qty*	71530-03A*
Part Description	Fork Lock
Customer Concern Code	0900
Condition Code	2202

* Will vary depending on quantity in stock.

Upon receipt of a properly completed claim, bar coded labels will be sent to the dealership that are to be returned with each fork lock. When Harley-Davidson Motor Company receives all the fork locks (P/N 71530-03A) held from a dealers inventory, the dealership will receive credit for parts and return postage.

Additional information

To check the status of Product Program 0900: Open h-dnet.com, go to Service, open Safety Campaigns and VIN Lists. All motorcycles involved in this program shipped to your dealership which still require service will appear under Campaign 0900. However, please note that this is a Product Program, **NOT** a recall.

To check the status of a VIN: Open h-dnet.com, go to Sales, Vehicle Registration and Inventory Management Main Menu, SWR Inquiry. Enter the VIN and click on Submit. Click on the View Safety Campaign History for VIN.

NOTES

- *Although not a safety recall, Product Program information beginning with program 0900 will be found on h-dnet.com.*
- *Previous product program information **will not** appear here.*
- *As per Dealer Communications letter dated May 10, 2006, Part No. 71530-03A is no longer available for DOM fairing equipped Touring Models. Part No. 71530-03A remains **ONLY** available for 2006 HDI Touring Models*



DEALER ORDER	PC
ORDER DATE	
DEALER NO.	
ORDER TYPE	
WARRANTY CLAIM NO.	

ORDER TYPE		VEHICLE IDENTIFICATION NUMBER (VIN)
TYPE CODE	REGULAR	
R	POLICE	
P	DOWN VEHICLE	
D	WARRANTY	
W	RECALL	
RC	PRODUCT CAMPAIGN	
PC		

S NAME _____
H _____
I _____
P _____
ADDRESS _____
T _____
O _____
CITY/STATE/ZIP _____

FOR OFFICE USE ONLY	
ACCT.	1745951
FRT. ACCT.	1745951

[illegible]

PLEASE USE PART NUMBERS  **DO NOT USE FOR**
CORRESPONDENCE 

ALL ORDERS SUBJECT TO ACCEPTANCE AT MILWAUKEE, WI 53201

All goods covered by this order, including goods back-ordered, will be billed at prices current at the time of shipment. Goods are purchased for resale and delivery is made to purchaser F.O.B. factory, Milwaukee, Wisconsin at other point of origin. If accepted, this order as accepted shall be subject to availability of goods to seller for delivery to purchaser. Any delay in shipment shall not relieve purchaser of responsibility for his acceptance of order and seller shall not be liable for any loss or damage due to delay in shipment or failure to deliver. Any request for cancellation of this order or any part thereof must be received by seller prior to the date of shipment, and in case of reacceptance or return of goods to seller, purchaser shall pay the entire cost connected therewith, plus zero, ten or twenty-five percent of selling price, as determined by Company's policy from time to time, as liquidated damages for loss of sale. Purchaser will be responsible for collection and payment of all Federal, State and local taxes that apply on the retail sales.

PLEASE USE PART NUMBERS

DO NOT USE FOR

CORRESPONDENCE

F-1040

PRINTED
IN U.S.A.

