SERVICE BULLETIN



M1435 2016-12-09

M1435: 2017 TOURING AND TRIKE FUEL PUMP - INTERNATIONAL MODELS ONLY

Purpose

Harley-Davidson has determined that a limited number of recently produced FL Touring and Trike models intended for certain international markets, may have been built with a fuel pump assembly containing an incorrect fuel pump motor.

Motorcycles Affected

Certain 2017 Touring, Trike, CVO and Police motorcycles intended for certain international markets are affected. The market offices have been provided with a suspect VIN list that includes approximately 200 motorcycles world-wide. Models include:

- FLHX
- FLHXS
- FLHXSE
- FLHTK
- FLHTKL
- FLHTKSE
- FLTRX
- FLTRXS
- FLTRU
- FLHR
- FLHRC
- FLHTCU
- FLHP
- FLHTCUTG
- FLRT

Markets Affected

Certain international markets are affected:

Parts Affected

· 62908-08 Fuel Pump Assembly

Symptoms

- · DTC B2119 may occur.
- Spitting/coughing/stalling (fuel starvation) occurs within 10-15 seconds after startup.

Required Dealer Action

If the symptoms described above are encountered during PDI, replace the fuel pump assembly (Part No. 62908-08). Clear DTCs.

File a PRD warranty claim using Customer Concern/Symptom code 1401, Labor code 7164 and Condition/Defect code 7164.

Part Return

Promptly return defective pump assembly to your local/regional Harley-Davidson office. Contact your local/regional office if you have any questions.



In the interest of preserving customer safety and satisfaction, always check for outstanding recalls whenever any motorcycle is brought into your dealership for either maintenance or service

The interest of preserving statemer street, and statement of street, and the interest and intere										stration of betvice.
	ROUTING	SERVICE MANAGER	SALES MANAGER	PARTS MANAGER	WARRANTY PROCESS MANAGER	LEAD TECHNICIAN	TECHNICIAN NO. 1	TECHNICIAN NO. 2	TECHNICIAN NO. 3	RETURN THIS TO
	INITIAL HERE									