SERVICE BULLETIN



M1449 2017-07-11

M1449: ABS WHEEL BEARING CHANGE

Purpose for Service Bulletin

This bulletin informs dealers that ABS (Anti-lock braking system) wheel bearing (Part No. 9252) has been superseded by a new ABS wheel bearing (Part No. 9252A).

See Figure 1. The **new** bearing is visually different than the old bearing. The old bearing had a tan seal (1). The **new** bearing has a gray seal (2).

Install the **new** bearing with the red side inboard and the gray side outboard, towards the installation tool.

Motorcycles Affected

This information applies to all ABS equipped motorcycles. Refer to Table 1.

Table 1. Motorcycles Affected

Years	Platform		
2008 - 2017	V-Rod		
2008 - 2017	Touring/Police		
2011 - 2017	Softail		
2012 - 2017	Dyna		
2014 - 2017	Sportster		
2017	Street		

Markets Affected

All markets are affected.

Affected Part/Kit

Affected kits that contain old bearing (Part No. 9252). Refer to Table 2.

Table 2. Affected Part/Kit

Part No.	Kit
42400010	KIT, WHEEL INSTALLATION FRONT 25MM ABS
43077-11	KIT-WHL INSTALL, RR/25MM AXLE, ABS
43077-11A	KIT-WHL INSTALL, RR/25MM AXLE, ABS
43093-11	KIT-WHL INSTALL, FRT/25MM AXLE, ABS
43093-11A	KIT-WHEEL INSTALL, FRT/25MM AXLE, ABS
42400003	KIT, INSTALL, RR, 25MM AXLE, DY ABS
42400009	KIT, WHEEL INSTALLATION FRONT 25MM ABS
41453-08A	KIT, WHEEL INSTALL 25MM AXLE
41453-08	KIT, WHEEL INSTALLATION 25MM BEAR-ING (ABS)
41453-08B	KIT, WHEEL INSTALL 25MM AXLE
41453-08C	KIT-WHL INSTALL, RR/25MM AXLE, ABS
41454-08	KIT, WHEEL INSTALLATION 25MM BEAR-ING (ABS)
41454-08A	KIT, WHEEL INSTALL 25MM BEARING (ABS)
41454-08B	KIT-WHL INSTALL, FRT/25MM AXLE, ABS
94749	RECALL KIT, CODE 0140, WHEEL KIT
42400009A	KIT-WHL INSTALL, FRT, 25MM AXLE, ABS

Required Dealer Action

Purge all stock of ABS wheel bearing (Part No. 9252) from inventory.

Remove bearing (Part No. 9252) from kits that are in stock and replace with the **new** bearing (Part No. 9252A). Refer to Table 2.

Hold all parts for 60 days as per the Credit Procedure.

After completing the rework, dealers can file a defective stock claim. Refer to Table 3.

Credit Procedure

Submit a warranty claim for all ABS wheel bearings (Part No. 9252) in dealer stock, including those from kits. Refer to Table 3.

NOTE

In the interest of preserving customer safety and satisfaction, always check for outstanding recalls whenever any motorcycle is brought into your dealership for either maintenance or service.

ROUTING	SERVICE MANAGER	SALES MANAGER	PARTS MANAGER	WARRANTY PROCESS MANAGER	LEAD TECHNICIAN	TECHNICIAN NO. 1	TECHNICIAN NO. 2	TECHNICIAN NO. 3	RETURN THIS TO
INITIAL HERE									

Table 3. Credit Procedure

ITEM	DATA
Claim Type	DFS / PAM - stock
Problem Part No.	9252
Quantity	Could vary
Customer Concern Code	9203
Condition Code	2108

Parts return: Hold all claimed parts for 60 days from date of credit issued for possible field inspection and/or request to return to factory. After 60 days, destroy and discard the parts.

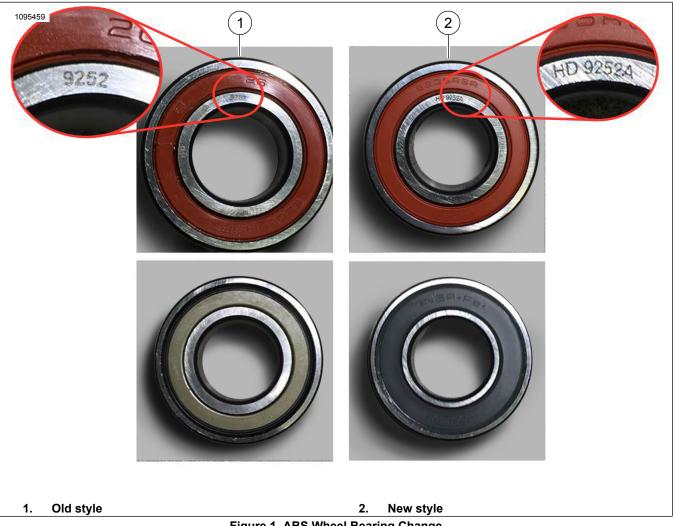


Figure 1. ABS Wheel Bearing Change

2/2 M1449