

March 01, 2004

EFI Tuner Download Issue

If after reprogramming an ECM with EFI Tuner you discover there is no check engine light and fuel pump power at ignition ON you likely have a "locked up" ecm. We believe there is a random communication issue that can occasionally confuse the download process. We are working to identify and correct it for future EFI Tuner kits. If you happen to encounter this problem, try the following process to restore communication:

Turn ignition Off.

Disconnect ECM for a few minutes then reconnect.

From the Windows screen, select Tuning Mode and reopen the desired calibration file.

Select Program ECM - the ECM Programming Control screen will appear.

Select Comport, reselect the correct port (Com 1, Com 2, etc) then Program ECM.

There is some additional help for communication problems right in the EFI Tuner software.

Click on the Tuning Mode icon.

Click I Accept

Pick a calibration file and open it.

You should be in Tuning Mode Basic Mode Active screen.

Go to the task bar and click on Help, then Contents.

Double click Programming ECM.

Click Programming Failure Recovery.