

Dyna Ignition Switch/Fork Lock

It is recommended that during servicing of any 2006 Dyna that the fork lock operation is inspected. If it is found that the fork lock is not working correctly due to the pin not aligning to the lower tree the lock retaining nut should be removed per the service manual procedure. Reinstall the nut per the Service Manual, make sure the fork lock pin aligns with the slot in the lower triple tree and apply a couple of drops of blue Loctite to the threads of the nut. If this is done it will require a new decal part# 14130-06 be applied on the FXD 35th and Wide Glides or part# 14117-06 decal for the other models. If a repair needs to be done a warranty claim can be filed using labor code 8888 for 0.2hrs in the Event Detail only of the claim.

