

TT296 – March 8, 2007

## Screamin' Eagle Big Twin Camshaft Kits

It has come to our attention that some of the PNA rear camshafts may have timing marks improperly located on the camshaft.

To help identify an improperly marked camshaft please refer to the following instructions:

1. See picture below. Look at the splined end of the camshaft, and locate the **WIDE** tooth.
2. In a clockwise direction, count the number of grooves to where the timing mark is located.
  - Timing marks in the 6<sup>th</sup> groove are **CORRECT**.

