

Destroyer Replacement Piston Markings

Use caution when servicing top end components on the Destroyer model as some pistons may be marked incorrectly.

The high compression pistons used in the VRXSE have clearanced areas machined in to allow clearance to the intake and exhaust valves at full lift. Note the piston orientation markings on the pistons in the image. The portion of the piston crown marked “EX” for exhaust is incorrectly marked and obviously on the side of the piston designed to receive the larger diameter intake valves.

The pistons can be used, just remember when installing pistons that have been incorrectly marked, to position the larger valve reliefs in the piston crown towards the intake side, and the smaller fly-cut areas go towards the exhaust.

Incorrect Piston Orientation Markings

