



## TT442: 2015 STREET PERFORMANCE DIAGNOSIS

February 3, 2014



Engine

APPLIES TO	SYMPTOMS
2015 Street models	<ul style="list-style-type: none"> <li>• Performance Concerns</li> </ul>

### Issue

See Figure 1. One possible cause is a loose fuel inlet filter connection at the main pump body. The connection is a one-time push-on fit that is not serviceable. Vehicles and parts built October 15, 2014 and later should not experience this condition.

### Resolution


#### NOTE

*Parts are fragile. Handle with care.*

Perform a fuel pressure test. See the service manual. If low fuel pressure is observed, remove and inspect the fuel pump assembly. If a loose connection is found, replace the complete fuel pump assembly.

#### NOTE

*Always inspect the new service part before installation to verify that the connection is solid.*

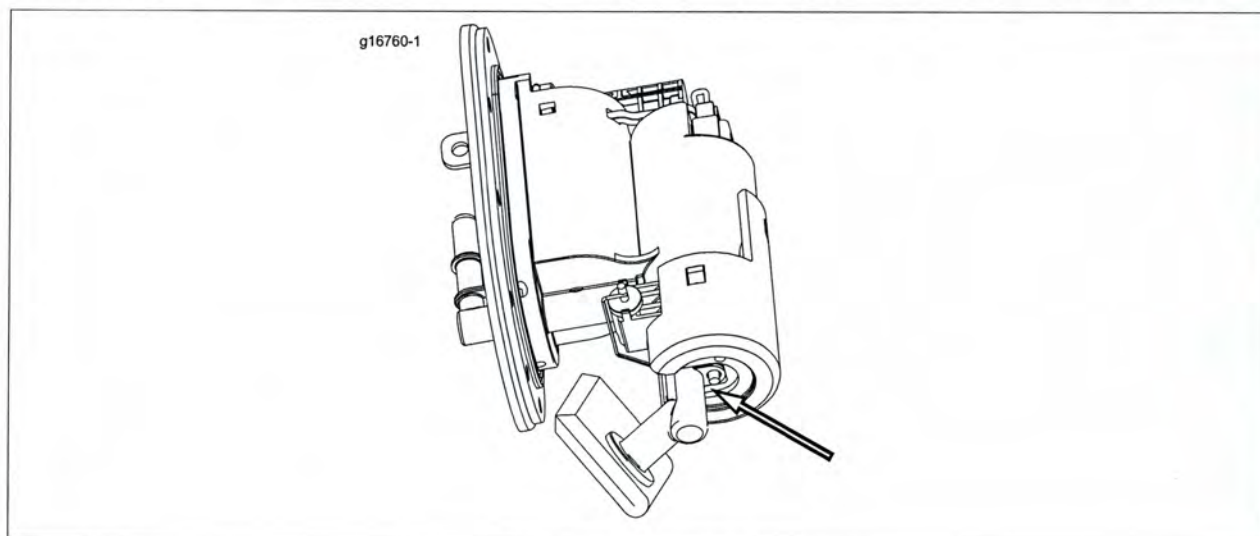

**Figure 1. Fuel Pump Assembly**