

SERVICE BULLETIN



M-839

October 2, 1981

BATTERY CABLE ROUTING — 1982 XL MODELS

The positive battery cable on some 1982 vehicles, prior to VIN 1HD1CAH15CY111159, may contact the leading edge of the oil tank. This surface could cut the insulation, causing a short circuit.

See Figure 1 and 2. Inspect all vehicles during predelivery and setup. Reroute cable, if required, per illustrations below.

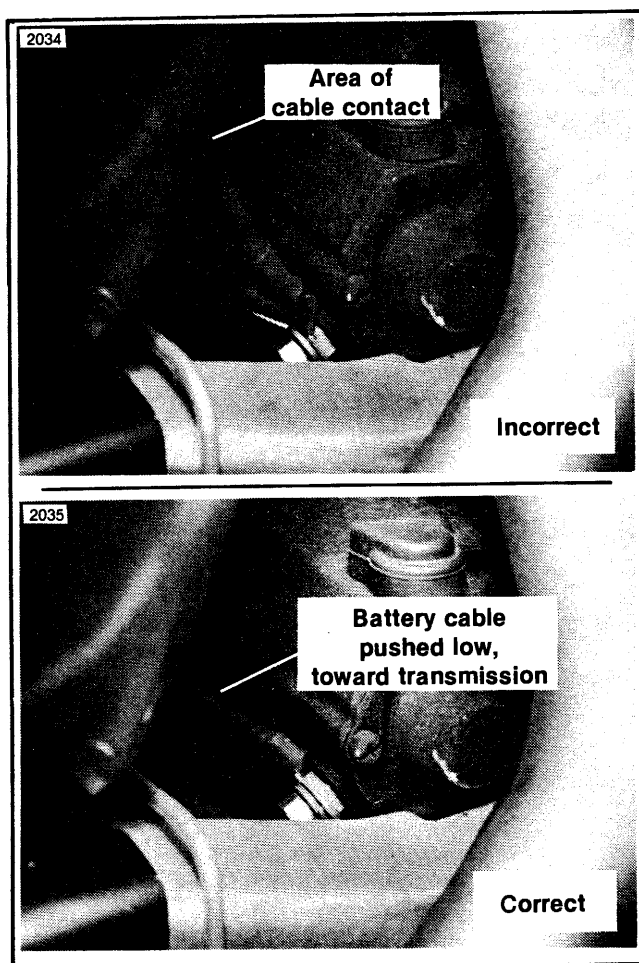


Figure 1. Connection to Starter

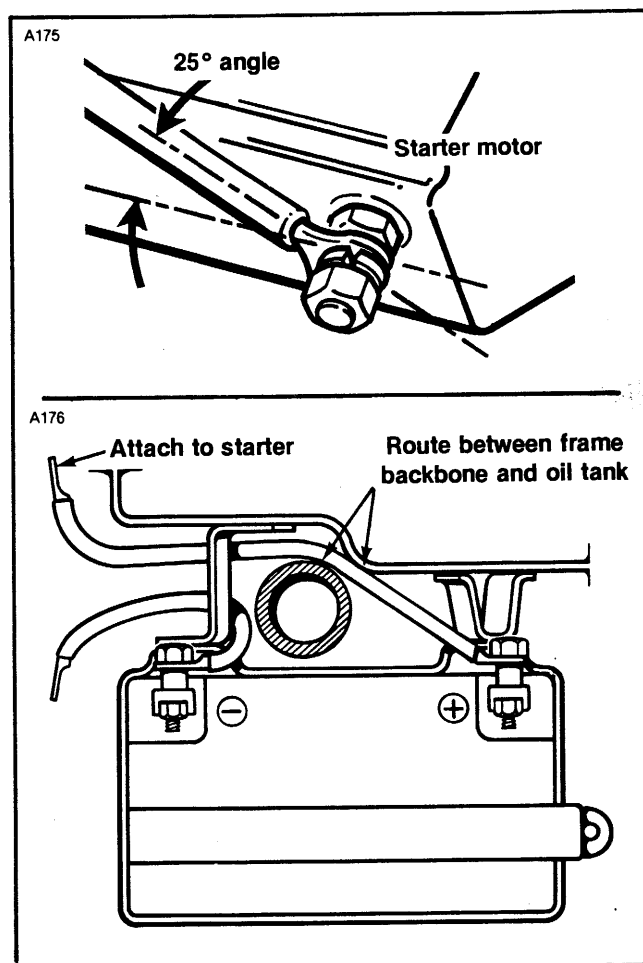


Figure 2. Battery Cable Routing