

Parts & Accessories Bulletin

July 14, 1987




P&A #350

XL SHIFTER CAM 34012-75B

It has come to our attention that shifter cam Part # 34012-75B will interfere with the crankcases when installed in 1975 or 1976 XL transmissions. See illustration. To avoid this interference the .375 diameter pin which is welded perpendicular to the plate, near the outside edge, must be cut off flush with plate

Thank you

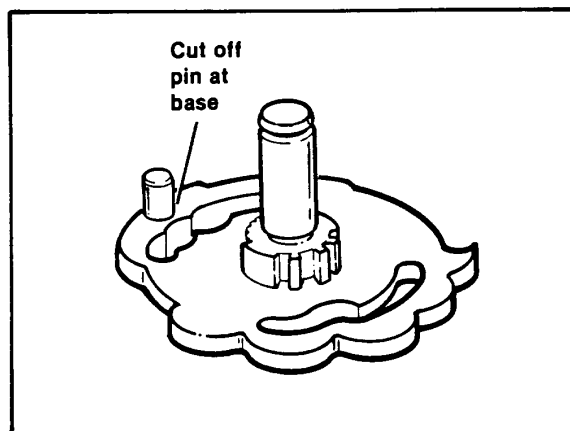

Gear Shifter Cam



FILE IN ACCESSORY GUIDE FOR FUTURE REFERENCE