


Sportster and Buell XB Model Flywheel Sprocket Shaft Nut Torque Update

The flywheel sprocket shaft nut torque for 2004 & later Sportsters and 2003 & later Buell XB models has been changed. The torque has been **increased** from 190-210 to **240-260 ft lbs**. Remember to clean the threads and generously apply LOCTITE Threadlocker 262 (red) onto the threads of engine sprocket shaft and use the SPROCKET LOCKING LINK (Part No. HD-46283 or HD-38362) as shown in the picture below.

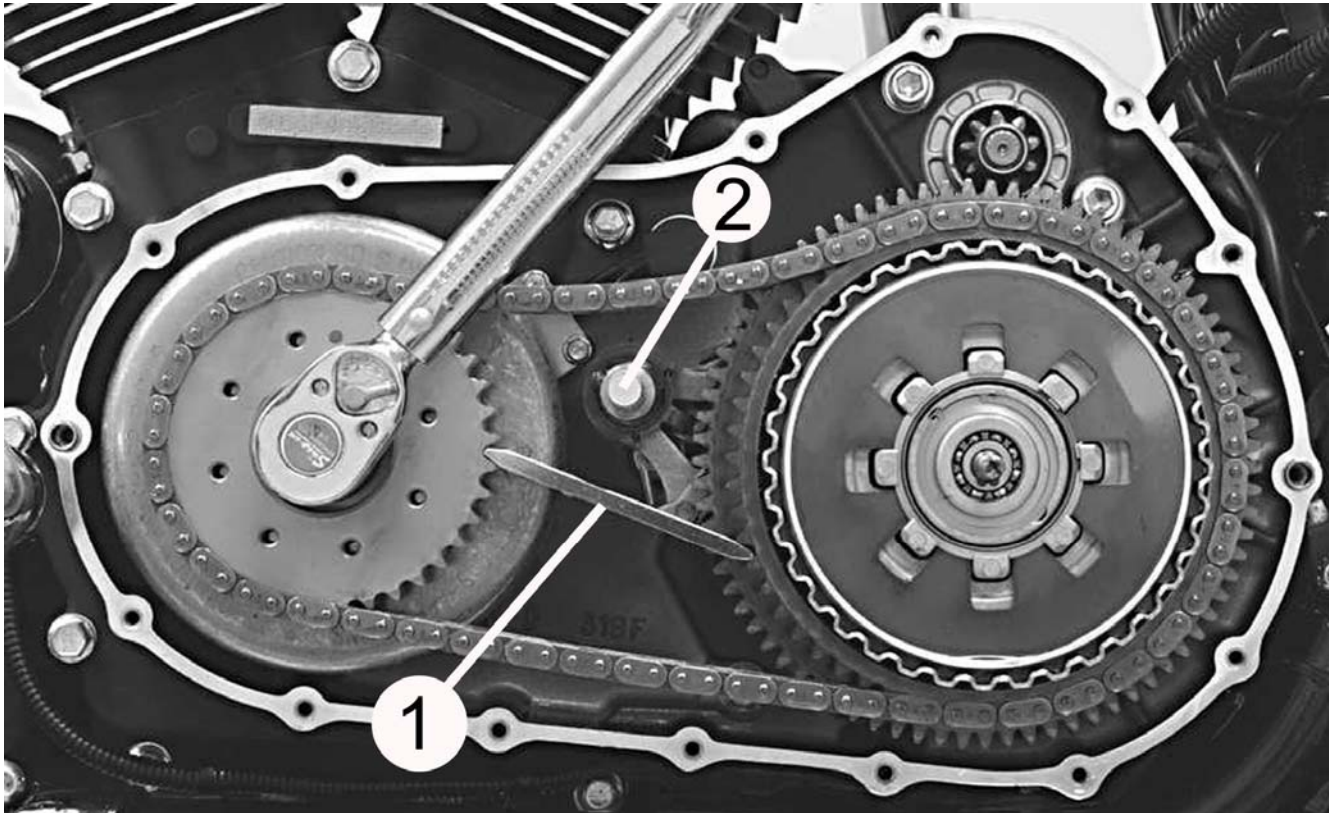

1. Sprocket Locking Link (Part No. HD-46283 or HD-38362)
2. Shifter Shaft