AMF HARLEY-DAVIDSON SERVICE BULLETIN

No. 671

October 7, 1974


REAR WHEEL SPOKES / SX-175 WITH WELDED STEEL HUB

On late 1975 SX-175 motorcycles, positive retention of the rear wheel spokes in the right side hub flange is accomplished by using washers underneath the spoke heads.

As an interim change some early 1975 motorcycles have nylon plugs installed between the spoke hooks in each slotted hole to accomplish the same purpose.

Any 1974 SX-175 motorcycles with welded steel rear wheel hub used for off-road service should be equipped with nylon plugs, part No. 70574-68 secured with part No. 2623W screws in each of the nine (9) slotted holes as shown below.

This will prevent the possibility of spoke heads unhooking from the wheel hub in case spokes become excessively loose.

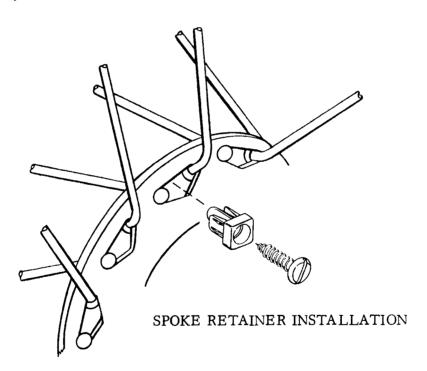

HARLEY-DAVIDSON MOTOR CO., INC.